
## Octopus Coat Hooks S.A.Bloom

 Using 1/2" square stock, prepare 8 pieces 5" long & 1 piece 2" long. Using the 5" stock, forge the terminal 3" into a gradual taper apprx. 8" long. Round the taper & curl the end.


 Bundle the 8 arms around the 2" piece, arc-weld the arms together, then forge weld into a single mass. Forge the head into a cylinder with a domed end.



s wage

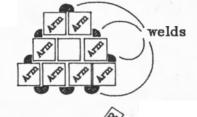

- 3. Using a hemispheric swage block, dish the head slightly. Form an eye with a round eye punch & add a horizontal pupil slit.
- 4. Shape the laterial rear arms & a center rear arm into attachment points. Shape the rest into protruding hooks (a torch will help).

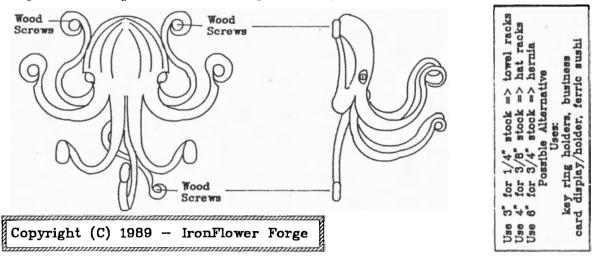

ABAWA chapter newsletters may reprint this article, provided the author's copyright is reproduced with the article and *The Florida Clinker Breaker* is credited as the source.